

## Direct comparative test of single crystal and polycrystalline diagnostic mirrors exposed in TEXTOR in erosion conditions

A. Litnovsky<sup>1</sup>, G. De Temmerman<sup>2</sup>, P. Wienhold<sup>1</sup>, V. Philipps<sup>1</sup>, O. Schmitz<sup>1</sup>, U. Samm<sup>1</sup>,  
G. Sergienko<sup>1</sup>, P. Oelhafen<sup>2</sup>, M. Rubel<sup>3</sup>, B. Emmoth<sup>4</sup>

<sup>1</sup>*Institut für Plasmaphysik, Ass. EURATOM, TEC, Forschungszentrum Jülich, Germany*

<sup>2</sup>*Institut für Physik, University of Basel, Switzerland*

<sup>3</sup>*Alfvén Laboratory, Royal Institute of Technology, Ass. EURATOM-VR, Stockholm, Sweden*

<sup>4</sup>*Dept. of Microelectronics, Royal Institute of Technology, Ass. EURATOM-VR, Kista, Sweden*

### Introduction

Metal mirrors are foreseen for ITER optical diagnostics [1]. There are concerns that erosion, deposition and particle implantation can change mirror performance in ITER. The choice of mirror materials is presently of crucial importance. Single crystal candidate materials, such as molybdenum and tungsten are believed to preserve their optical properties under erosion conditions unlike the polycrystalline ones. This was confirmed in laboratory tests [2]. The dedicated experiment was needed to allow the direct comparison of single crystal and polycrystalline mirrors in the tokamak environment. Such an experiment was made in TEXTOR. The parameters in the SOL plasma of TEXTOR are such that ion energy corresponds to the CX neutral energies that are expected to cause erosion of mirrors in ITER [3]. The same time, ion flux densities in the SOL plasma of TEXTOR are much higher than CX neutral flux densities on the first wall of ITER. Therefore, there is an advantage in one day exposure to simulate the effect of several hundreds of ITER discharges.

The experiment consisted of three stages. At the first stage, the optical and surface pre-characterization of mirrors was made in the University of Basel (Switzerland) and in the Institute of Plasma Physics, Research Centre in Jülich (Germany). After pre-characterization the mirrors were exposed in the erosion dominated conditions in the SOL plasma of TEXTOR tokamak in the same plasma environment for series of identical shots. After the exposure, the complete surface and optical characterization was made again.

### Mirror pre-characterization.

Three mirrors were used in the experiment: mirror made from polycrystalline molybdenum (PC Mo), mirror made from single crystal molybdenum [110] (SC Mo) and mirror made from single crystal tungsten [111] (SC W). Single crystal mirrors were supplied

by Kurchatov Institute, Moscow. In this paper we will focus on the analysis of molybdenum mirrors.

During pre-characterization it was detected, that the SC molybdenum mirror was oxidized during storage in the air. This oxidation caused a drop in the total reflectivity in the UV region down to 35% against 65% described in the literature [4]. Hydrogen discharge cleaning was applied and after 2 exposures for 15 minutes each, the reflectivity of mirror was successfully recovered. Detailed description of cleaning procedure will be given elsewhere.

The optical pre-characterization included measurements of total and diffuse reflectivity in the wavelength range of 250-2500 nm and polarization measurements at several angles of incidence: 45°, 55°, 65°. Polarization measurements were made in the range of 300-800 nm. Surface pre-characterization comprised the X-Ray Photoelectron Spectroscopy (XPS) measurements for elemental analysis of the mirrors and stylus profiling for assessing the planarity and surface curvature of mirrors.

#### Exposure in TEXTOR

For the exposure all three mirrors were placed in a row on the specially instrumented limiter. The limiter with mirrors was exposed in the SOL plasma of TEXTOR under erosion-dominated conditions in the same plasma environment. 36 NBI-heated plasma discharges were carried out with total duration of 210 seconds. Optical pyrometers were used to monitor the temperature of mirrors. The temperature of the limiter was measured with thermocouples and was varying between 200°C and 270°C degrees during the exposure. Electron density and temperature were measured with He beam diagnostic. The energy of D<sup>+</sup> ions impinging the surface of mirrors was in the range of 200 - 250 eV. Ion flux density was  $2.4 \cdot 10^{18}$  ion/(cm<sup>2</sup>\*sec) which is approximately 25000 times larger than expected for flux of CX neutrals on the first wall in ITER [5]. Total fluence averaged over mirror surface was  $1.7 \cdot 10^{20}$  ion/cm<sup>2</sup>, which corresponds to more than 1000 ITER discharges. The limiter with mirrors after the exposure is shown on Fig. 1.

#### Effect of erosion on single crystal and polycrystalline mirrors

The total reflectivity of mirrors was measured after exposure on the same locations as before it. The results are shown in Fig. 2. The total reflectivity of both mirrors didn't change much under erosion conditions. In turn, the effect of erosion on diffuse reflectivity was dramatic. The dependence of diffuse reflectivity on wavelength is plotted on Fig. 3. For the

polycrystalline Mo mirror there is a drastic increase of diffuse reflectivity, especially pronounced in the region 250-1000 nm. For the SC mirror the diffuse reflectivity remains unchanged.

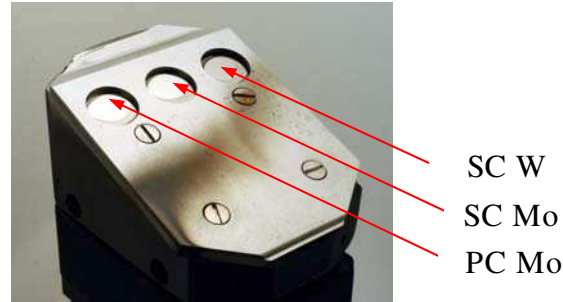


Fig. 1. The limiter with mirrors after exposure in the SOL of TEXTOR

Specular reflectivity plots  $R_{spec} = R_{tot} - R_{diff}$  are shown in Fig.4. In fact, the specular reflectivity is one of the most important characteristics of a diagnostic mirror for ITER, since it sets the amplitude of signal transmitted from plasma radiation towards the detecting hardware. As it can be inferred from the Fig. 4, the SC Mo mirror keeps its specular reflectivity while the reflectivity of polycrystalline molybdenum mirror is significantly deteriorated after exposure. The reason for this deterioration is an increase of diffuse reflectivity, likely caused by the surface relief of polycrystalline mirrors. Indeed, Scanning Electron Microscope (SEM) photos showed the presence of so-called “step-structure” [6] on the polycrystalline mirror, while single crystal remained plain after erosion.

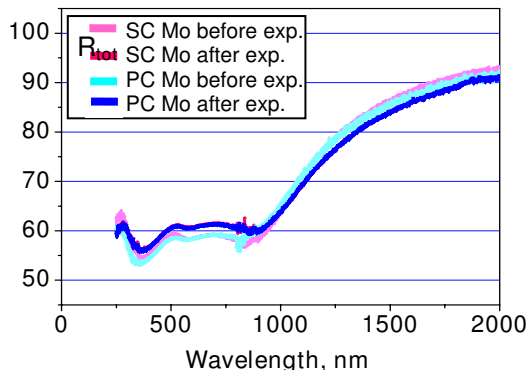


Fig.2. Total reflectivity of molybdenum mirrors before and after exposure

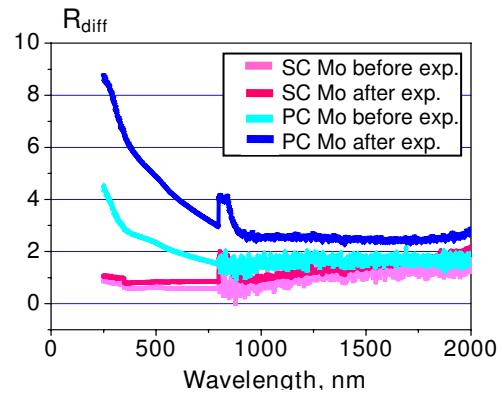


Fig. 3. Diffuse reflectivity of molybdenum mirrors before and after exposure

Polarization measurements were made for the parallel  $R_p$  and perpendicular  $R_s$  components of the light vector in dependence on wavelength and on the angle of incidence. In both cases, measurements revealed little or no effect of erosion on polarization characteristics. Some results are plotted in Fig. 5 as an example. As it can be observed from the Fig. 5, the measured values are in good agreement with theory predictions [5].

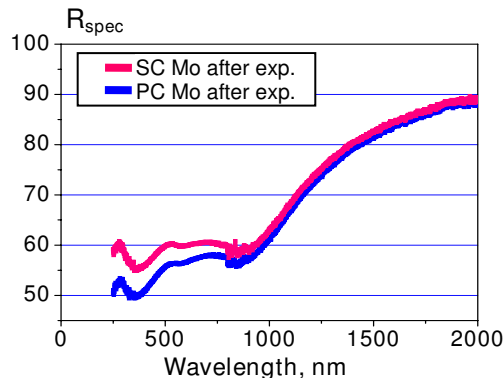


Fig.4. Specular reflectivity of molybdenum mirrors after exposure

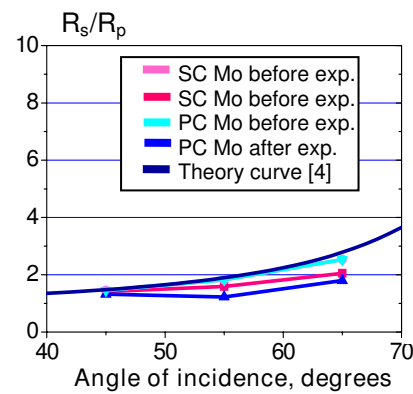


Fig.5. Polarization at different angles of incidence.  $R_p$  and  $R_s$  are parallel and perpendicular components of light vector respectively.

### Summary

First direct comparative test of single crystal and polycrystalline diagnostic mirror materials under erosion conditions has been made in TEXTOR. Before exposure in TEXTOR, glow discharge cleaning has efficiently restored the reflectivity of initially oxidized mirrors. After the exposure, no significant changes in total reflectivity were observed. Drastic increase of diffuse reflectivity was measured for polycrystalline molybdenum mirror, but not for the single crystal. Thus, specular reflectivity of single crystal is significantly higher than of polycrystalline one. The most affected wavelength range is 250-1000 nm, no significant changes of reflectivity was noticed in the range 1000-2000 nm. No or negligible effect of erosion on polarization characteristics of mirrors was measured.

### Acknowledgements

The authors are grateful to Dr. K. Vukolov (RRC “Kurchatov Institute”) for supplied single crystal mirrors.

### References:

- [1] V. Voitsenya et al., Review of Scientific Instruments, Vol. 72, No. 1 (Jan. 2001) 475;
- [2] A.J.H. Donné et al, Proc. of 19<sup>th</sup> IAEA Fus. Ener.Conf., CT/P-10, Lyon, France, 2002;
- [3] M. Mayer, et al.”Change of optical reflectivity of mirror surfaces exposed to JET plasmas” in Diagnostics for Experimental Thermonuclear Fusion Reactors, vol 2. Ed. Stott et al., Plenum Press, New York, 1998, p. 279-286;
- [4] ”Handbook of optical constants of solids”, E.D.Palik, Acad. Press, 1985;
- [5] A. Costley et al. Fusion. Eng. and Des. 55(2001) 331-346 ;
- [6] V. Voitsenya et al, J. Nucl. Mater. 290-293 (2001) 336-340.